

**TO: Niles IntelliControl ICS Dealers and Sales Reps**

**FROM: Niles Technical Support**

**DATE: November 20, 2007**

**RE: IntelliFile3 Revision 106 Release**

Niles is pleased to announce that revision 106 of IntelliFile3 software successfully completed validation testing and has been officially posted to the Niles Audio website for download. It is imperative that any previous version of the IntelliFile3 software is removed from computers and replaced with revision 106.

Revision 106 provides implementation of the Niles DMS4 Music Server.

In response to dealer requests other improvements include:

- “Source In Use” indication on keypads and iRemotes
- The ability to hide settings from the end user in the “System Setting” menu(e.g. audio settings)
- AM/ FM tuners now have programmable “previous” and “next” buttons
- Linked zones can now have linked or independent volume

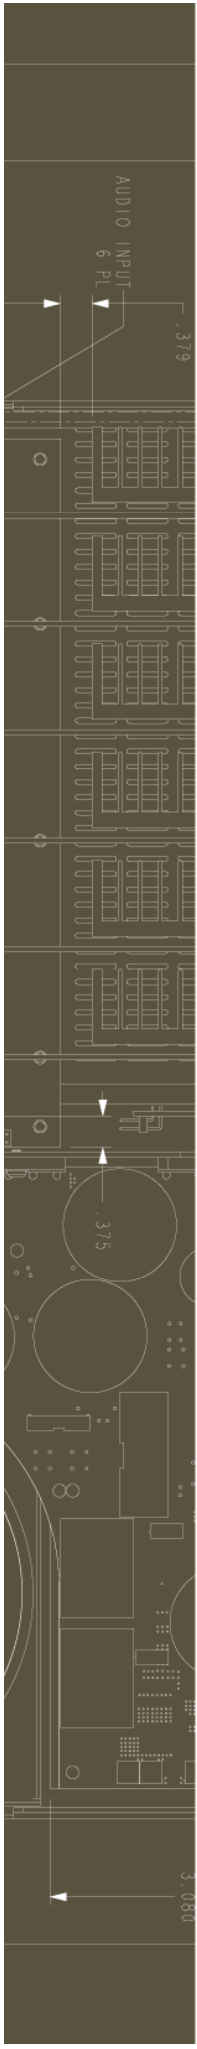
A complete list of these improvements is posted on the update portion of the website.

**\*\*\*IMPORTANT\*\*\***

*Revision 106 must be installed on your computer in order to install and configure a DMS4 on a Niles ICS system.*

Technical support strongly suggests you adhere to the following steps to insure a successful update of your IntelliFile3 software:

1. If connected, disconnect the IntelliFile3 infrared capture station from your laptop computer.
2. Copy the contents of the following folders from your C:\IntelliFile3 folder to a new folder on your desktop: “ICS Files” and “IR Files”. This will safeguard your customer files and IR code files.

- 
3. Uninstall the current version of the IntelliFile3 software on your computer using Windows “Add/ Remove Programs” in the Control Panel.
  4. Delete the IntelliFile3 folder from your C drive.
  5. Download revision 106 to your desktop. It can be found at: <http://www.intellicontrol.com/techsupport/intellifile3.htm>
  6. Double click the setup icon on your desktop and follow the installation instructions.
  7. When installation is complete copy the “ICS Files” and “IR Files” you saved to your desktop back into the new IntelliFile3 folder on your C drive.
  8. Reconnect your IntelliFile3 infrared capture station to your laptop.

**Note:** When updating the firmware of your system it is imperative that all iPods are disconnected from their respective IM-iPod cards and any components being controlled via a RS-232G or the IM-SERVER card are disconnected from their respective ports.

Should you have any questions, please feel free to contact Niles Technical Support at 1-800-289-4434 between the hours of 8am and 7pm Eastern Time, Monday - Friday.